


Horizontal Tee

PG/PC/TA

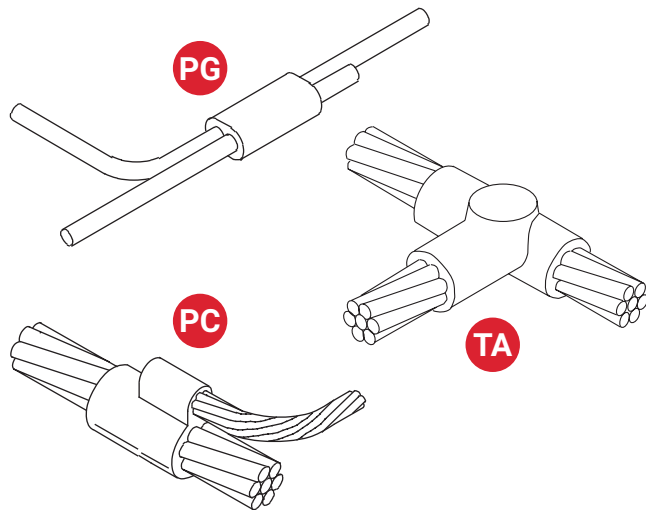

Cable Size	Run	Tap	Mold Part No.	Weld Metal
6 SOL	6	6 SOL	PGT-1G1G	25
		6	PGT-1H1H	25
		4	TAC-1L1L	32
4	4	6	PCT-1L1H	32
		6 SOL	PCT-1L1G	32
		8	PCT-1L1E	32
		8 SOL	PCT-1L1D	32
		2	TAC-1T1V	45
2 SOL	2 SOL	2 SOL	TAC-1T1T	45
		4	TAC-1T1L	45
		6	PCT-1T1H	32
		6 SOL	PCT-1T1G	32
		8	PCT-1T1E	32
2	2	8 SOL	PCT-1T1D	32
		2	TAC-1V1V	45
		2 SOL	TAC-1V1T	45
		4	TAC-1V1L	45
		6	PCT-1V1H	32
		6 SOL	PCT-1V1G	32
		8	PCT-1V1E	32
		8 SOL	PCT-1V1D	32
		1	TAC-1Y1Y	45
		2	TAC-1Y1V	45
1	1	2 SOL	TAC-1Y1T	45
		4	TAC-1Y1L	45
		6	PCC-1Y1H	45
		6 SOL	PCC-1Y1G	45
		8	PCC-1Y1E	45
		8 SOL	PCC-1Y1D	45

HORIZONTAL TEE CONNECTIONS

- Tee of horizontal run and tap cables.
- PC and PG make parallel style connections which the user can form into a tee.
- Concentric stranded copper cable unless otherwise noted.
- Solid conductor can be either copper or Copperweld®.
- **Bold letter** in mold part number is the price key.

REQUIRED TOOLS

- Handle Clamps** **L160** for **C** Price Key Molds
L159 for **D** Price Key Molds
 Clamps are included with T Price Key Molds
- Flint Ignitor** **T320** (Included with Handle Clamp or frame but also available separately)

SUGGESTED TOOLS

- Cable Cleaning Brush T313 or T314
 Slag Removal Spade B136A or B136B
 Mold Cleaning Brush T394
 Cable Clamp B265
 Torch Head T111

ACCESSORIES

See Section A

Cable Size	Run	Tap	Mold Part No.	Weld Metal
1/0	1/0	1/0	TAC-2C2C	90
		1	TAC-2C1Y	45
		2	TAC-2C1V	45
		2 SOL	TAC-2C1T	45
		4	TAC-2C1L	45
		6	PCC-2C1H	45
		6 SOL	PCC-2C1G	45
		8	PCC-2C1E	45
		8 SOL	PCC-2C1D	45
		2/0	TAC-2G2G	90
2/0	2/0	1/0	TAC-2G2C	90
		1	TAC-2G1Y	45
		2	TAC-2G1V	45
		2 SOL	TAC-2G1T	45
		4	TAC-2G1L	45
		6	PCC-2G1H	65
		6 SOL	PCC-2G1G	65
		8	PCC-2G1E	65
		8 SOL	PCC-2G1D	65

Horizontal Tee

PG/PC/TA

Cable Size	Tap	Mold Part No.	Weld Metal
Run			
3/0	3/0	TAC-2L2L	115
	2/0	TAC-2L2G	90
	1/0	TAC-2L2C	90
	1	TAC-2L1Y	45
	2	TAC-2L1V	45
	2 SOL	TAC-2L1T	45
	4	TAC-2L1L	45
	6	PCC-2L1H	90
	6 SOL	PCC-2L1G	90
	8	PCC-2L1E	90
	8 SOL	PCC-2L1D	90
4/0	4/0	TAC-2Q2Q	150
	3/0	TAC-2Q2L	115
	2/0	TAC-2Q2G	90
	1/0	TAC-2Q2C	90
	1	TAC-2Q1Y	90
	2	TAC-2Q1V	90
	2 SOL	TAC-2Q1T	90
	4	TAC-2Q1L	90
	6	PCC-2Q1H	90
	6 SOL	PCC-2Q1G	90
250	250	TAC-2V2V	150
	4/0	TAC-2V2Q	150
	3/0	TAC-2V2L	150
	2/0	TAC-2V2G	90
	1/0	TAC-2V2C	90
	1	TAC-2V1Y	90
	2	TAC-2V1V	90
	2 SOL	TAC-2V1T	90
	4	TAC-2V1L	90
	300	TAC-3A3A	200
300	250	TAC-3A2V	150
	4/0	TAC-3A2Q	150
	3/0	TAC-3A2L	150
	2/0	TAC-3A2G	90
	1/0	TAC-3A2C	90
	1	TAC-3A1Y	90
	2	TAC-3A1V	90
	2 SOL	TAC-3A1T	90
	4	TAC-3A1L	90

Cable Size	Tap	Mold Part No.	Weld Metal
Run			
350	350	TAC-3D3D	200
	300	TAC-3D3A	200
	250	TAC-3D2V	200
	4/0	TAC-3D2Q	150
	3/0	TAC-3D2L	150
	2/0	TAC-3D2G	90
	1/0	TAC-3D2C	90
	1	TAC-3D1Y	90
	2	TAC-3D1V	90
	4	TAC-3D1L	90
500	500	TAC-3Q3Q	2-150
	350	TAC-3Q3D	200
	300	TAC-3Q3A	200
	250	TAC-3Q2V	200
	4/0	TAC-3Q2Q	150
	2/0	TAC-3Q2G	90
	1/0	TAC-3Q2C	90
	1	TAC-3Q1Y	90
	2	TAC-3Q1V	90
	4	TAC-3Q1L	90
750	750	TAD-4L4L	500
	500	TAD-4L3Q	2-200
	350	TAC-4L3D	250
	300	TAC-4L3A	200
	250	TAC-4L2V	200
	4/0	TAC-4L2Q	150
	2/0	TAC-4L2G	150
	1/0	TAC-4L2C	150
	1000	TAD-4Y4Y	500
	750	TAD-4Y4L	500
1000	500	TAD-4Y3Q	2-200
	350	TAC-4Y3D	250
	300	TAC-4Y3A	200
	250	TAC-4Y2V	200
	4/0	TAC-4Y2Q	150
	2/0	TAC-4Y2G	150
	1/0	TAC-4Y2C	150